



**Repair
Procedure 1:
Combination
Meter
Computer
(Continued)**

- 12. Install Combination Meter Cover No. 3.
 - A. Install the combination meter reflector No. 1 with the 4 screws.

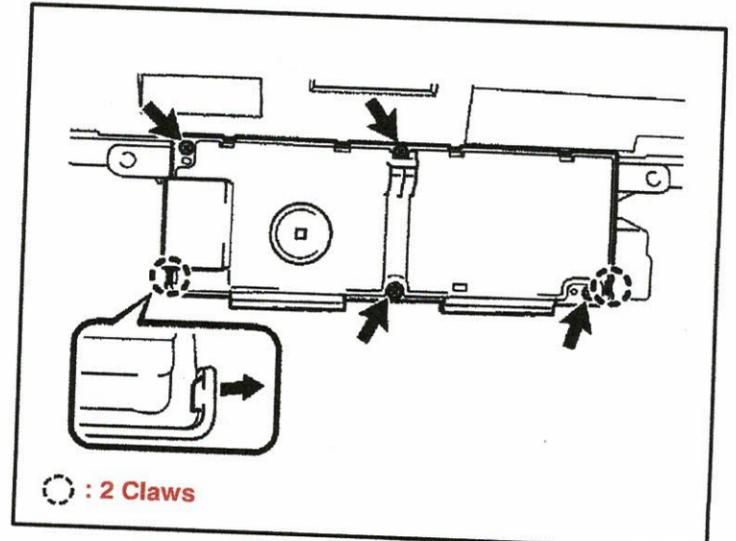

- 13. Install Combination Meter Cover RH.
 - A. Install the combination meter cover RH with the screw.

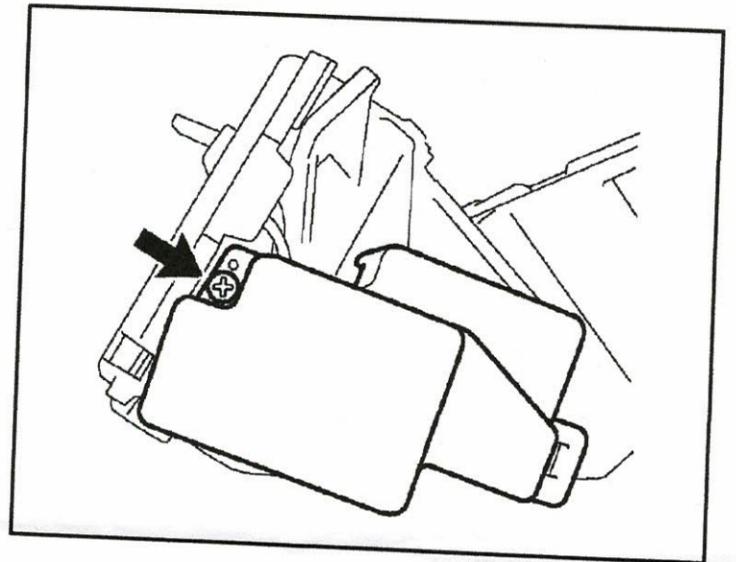

- 14. Install Combination Meter in Reverse of Disassembly.


- 15. Reset Inclination Sensor.

HINT:
After replacement of the combination meter computer, reset the standard horizontal angle of the inclination sensor.

- A. Keep the vehicle stationary in both longitudinally and laterally horizontal position (within +/- 0.3°).


HINT:
Place the vehicle on a level surface such as an alignment rack, if available.

- B. Switch to the "Trip A" mode of the odometer display.
- C. Turn the power switch OFF.

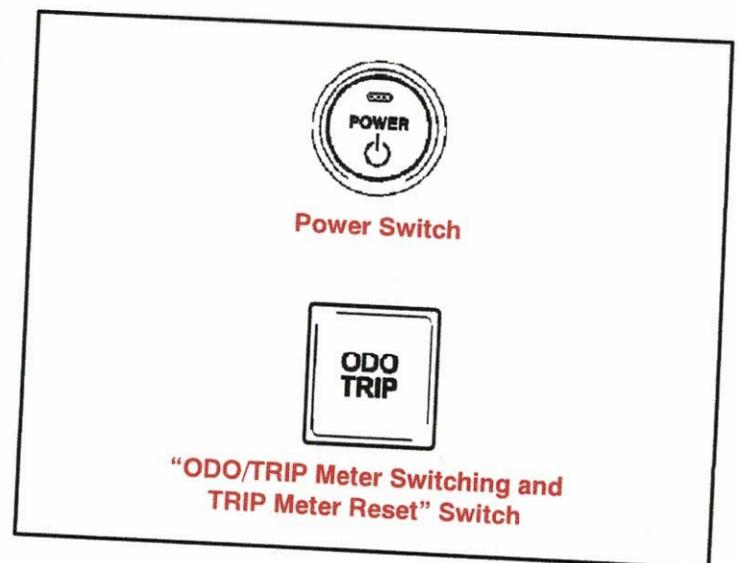

**Repair
Procedure 1:
Combination
Meter
Computer
(Continued)**

- D. Make sure your foot is off of the brake pedal.
- E. Push in and hold the "ODO/TRIP" button.
- F. Turn the power switch ON (push the "POWER" button twice).
- G. Turn the "ODO/TRIP" button OFF, then ON 3 times within 5 seconds.
- H. Continue to hold the "ODO/TRIP" button until the "ODO" indicator in the display turns off and a 6-digit code (#####) is displayed.
- I. Release the "ODO/TRIP" button.
- J. Push and hold the "ODO/TRIP" button for 5 seconds or more again. The 6-digit code (#####) will then change to a 5-digit code (#####).
- K. After "1" is displayed at the 3rd digit of the 5-digit code, release the "ODO/TRIP" button.
- L. Approximately 5 seconds after "1" is displayed at the 3rd digit, the "TRIP A" indicators are displayed, and the odometer returns to the normal operation.

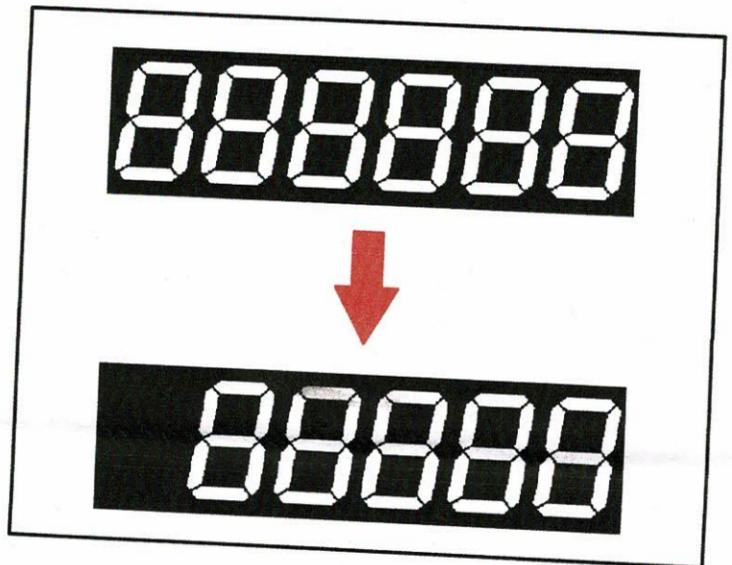

The diagram shows a 5-digit display with three brackets underneath. The first bracket is labeled 'X', the second 'Y', and the third 'Z'.

X: Values Written Into Meter (Longitudinal Direction)
Y: Write Status and Result
Z: Values Written Into Meter (Lateral Direction)

Write Status and Result:
0: Writing
1: Write Completed
2: Write Error
3: Write Canceled

NOTE:

- The "TRIP A" mileage will revert to 0.0 miles in this procedure.
- Do not drive the vehicle before the reset procedure has been completed.

HINT:
If a write error occurs, start the procedure again from the beginning.