


LANDROVER DISCOVERY ABS MODULATOR REMOVAL

Modulator Unit - ABS

Remove

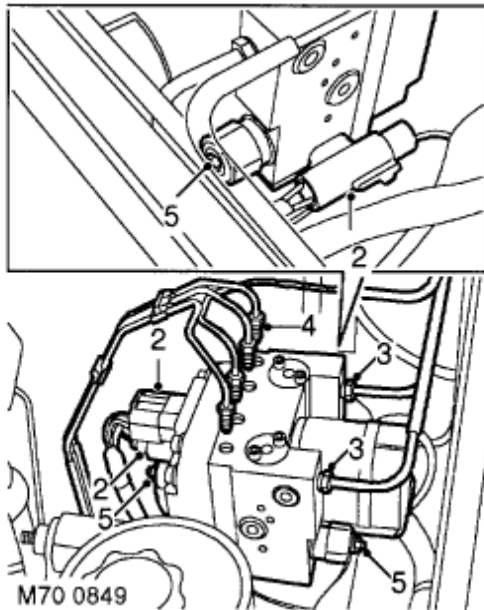

1. Position cloth under modulator to absorb fluid spillage. **CAUTION:** Brake fluid will damage paint finished surfaces. If spilled, immediately remove fluid and clean area with water.
2. Disconnect 3 multiplugs from ABS modulator.
3. Disconnect 2 inlet brake pipe unions from pump side of modulator. **CAUTION:** Always fit plugs to open connections to prevent contamination.
4. Disconnect 4 outlet brake pipe unions from top of modulator. **CAUTION:** Always fit plugs to open connections to prevent contamination.

- 5. Loosen 3 nuts securing modulator to mounting bracket.**
- 6. Release and remove modulator from mounting bracket.**
- 7. Remove 3 mounting rubbers from modulator.**

Refit

- 1. Position mounting rubbers to modulator.**
- 2. Position modulator to mounting bracket, tighten nuts to 9 Nm (7 ft. lbs.) .**
- 3. Clean brake pipe unions.**
- 4. Connect brake pipe unions to modulator ensuring pipes are connected to their correct ports.**
- 5. Tighten 13 mm unions to 22 Nm (16 ft. lbs.) and 11 mm unions to 14 Nm (10 ft. lbs.) .**
- 6. Connect multiplugs to modulator.**
- 7. Bleed brakes.**